

Engine: All Technical Service Bulletins

Ignition Distributor - Install Ventilation When Serviced

Group

2

Number

9403

Model

6 Cyl.

Part Identifier

2830

March 29, 1994

Subject:

Ignition Distributor Ventilation

ATTENTION: Service Manager / Service Technician

Models Affected:

911 Carrera 2/4, as of model year 1989

Concern:

Ventilation for ignition distributor must be installed if replacement of ignition distributor becomes necessary.

General Information:

From August 13, 1993 production date, the ignition distributor received a ventilation system as of engine numbers:

62 R 00592 - Manual Transmission

62 R 50520 - Tiptronic

If the ignition distributor requires replacement, on engines produced prior to the above engine numbers, a ventilation system must also be installed on replacement distributors which do not have it. After present stocks of new and rebuilt distributors are depleted only distributors with ventilation connection will be available.

Repair Information:

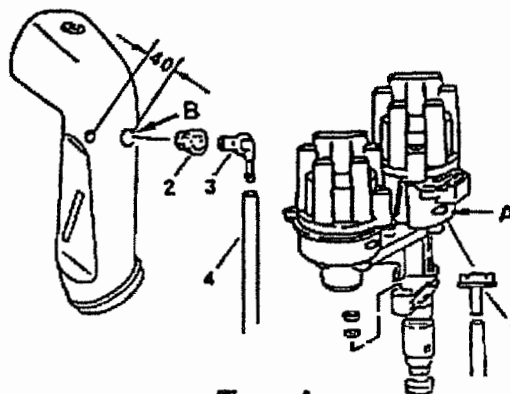


Figure A

See Figure A.

- Use a screwdriver to remove the oval plate (arrow A) on the ignition distributor.
- Install ventilation connector (1) into distributor.
- Remove air guide pipe.
- Drill an 18 mm diameter hole (B) 40 mm to the right of the tail light ventilation into the air guide pipe.